

**DEPARTMENT OF TRANSPORTATION**

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch  
690 Walnut Ave. St. 150  
Vallejo, CA 94592-1133  
(707) 649-5453  
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-021226**Date Inspected:** 07-Feb-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Geng Wei**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG Components**Summary of Items Observed:**

On this date Caltrans Office of Structural Materials Quality Assurance Inspector, Sandeep Kumar (QA) was present during the times noted above for observations relative to the work being performed.

BAY#14

East Side

This QA Inspector observed the following work in progress

Shielded Metal Arc Welding (SMAW):

Repair welding of a weld joint #037 located on 14E, SEG3019BB as per the critical weld repair report # B-CWR2737. Welder is identified as 066422. ZPMC Quality Control (QC) Inspector is identified as Guo Xing Hui. The welding variables recorded by QC appeared to comply with the WPS-345-SMAW-2G (2F)-FCM-Repair. (See attached photo)

Weld joint #144 located on 13BE, SEG3009B. Welder is identified as 067571. ZPMC Quality Control (QC) Inspector is identified as Zhong Yong Gang. The welding variables recorded by QC appeared to comply with the WPS-B-P-2214-B-U2-FCM-1.

Flux Cored Arc Welding (FCAW):

Weld joint #132 located on 14E, SEG3019AZ. Welder is identified as 068501. ZPMC Quality Control (QC) Inspector is identified as Guo Xing Hui. The welding variables recorded by QC appeared to comply with the

---

## WELDING INSPECTION REPORT

( Continued Page 2 of 3 )

---

WPS-B-T-2233-ESAB.

Weld joint #179 located on 14E, SEG3019BB. Welder is identified as 067877. ZPMC Quality Control (QC) Inspector is identified as Guo Xing Hui. The welding variables recorded by QC appeared to comply with the WPS-B-T-2233-ESAB.

Weld joint #006 located on 13CE, SEG3011F. Welder is identified as 214945. ZPMC Quality Control (QC) Inspector is identified as Zhong Yong Gang. The welding variables recorded by QC appeared to comply with the WPS-B-T-2232-ESAB.

Weld joint #165 located on 14E, SEG3019AZ. Welder is identified as 066733. ZPMC Quality Control (QC) Inspector is identified as Guo Xing Hui. The welding variables recorded by QC appeared to comply with the WPS-B-T-2233-ESAB.

Weld joint #006 located on 13CE, SEG3011B. Welder is identified as 066041. ZPMC Quality Control (QC) Inspector is identified as Zhong Yong Gang. The welding variables recorded by QC appeared to comply with the WPS-B-T-2232-ESAB.

Weld joint #131 located on 14E, SEG3019AZ. Welder is identified as 068501. ZPMC Quality Control (QC) Inspector is identified as Guo Xing Hui. The welding variables recorded by QC appeared to comply with the WPS-B-T-2233-ESAB.

Weld joint #006 located on 13CE, SEG3011H. Welder is identified as 066881. ZPMC Quality Control (QC) Inspector is identified as Zhong Yong Gang. The welding variables recorded by QC appeared to comply with the WPS-B-T-2232-ESAB.

Weld joint #003 located on 14E, SEG3019BB. Welder is identified as 066763. ZPMC Quality Control (QC) Inspector is identified as Guo Xing Hui. The welding variables recorded by QC appeared to comply with the WPS-B-T-2233-ESAB. (See attached photo)



Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

---

# WELDING INSPECTION REPORT

( Continued Page 3 of 3 )

---

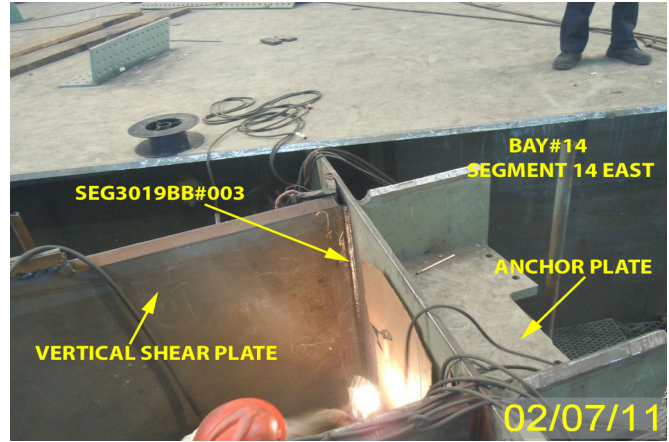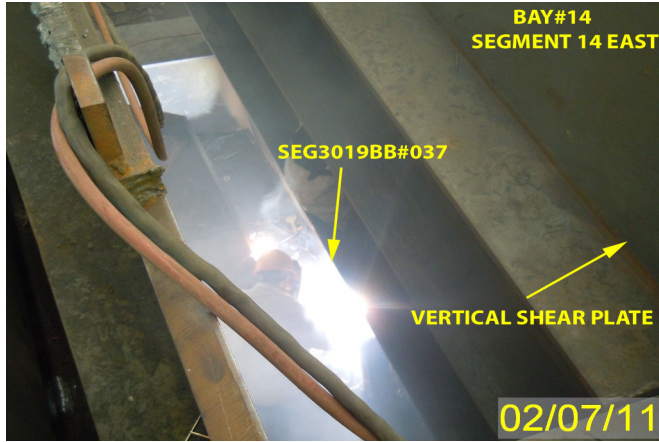

## Summary of Conversations:

No Relevant Conversations.

## Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang - 15000422372, who represents the Office of Structural Materials for your project.

---

<b>Inspected By:</b>	Kumar,Sandeep
<b>Reviewed By:</b>	Patterson,Rodney

---

Quality Assurance Inspector
QA Reviewer

---